


CESSNA

320C

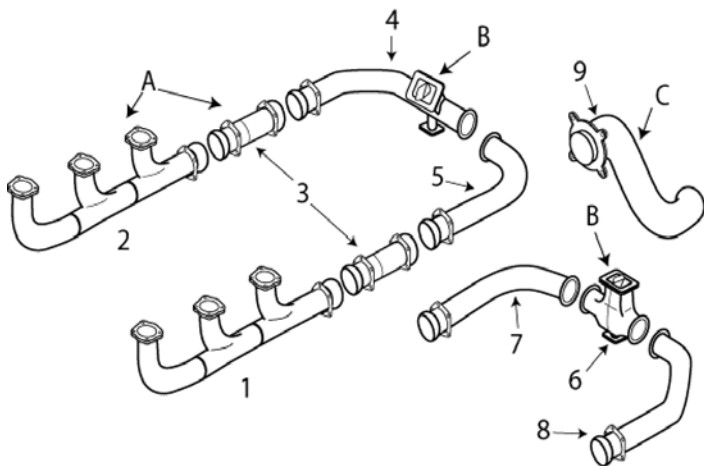

Subject to AD 2000-01-16

AWI is authorized by the FAA to meet the overhaul requirements (paragraph "G") on AD 2000-01-16.

Visual inspection every 50 hrs. or 30 days
 Remove tailpipes inspect for cracks every 12 mo.
 Inspect & pressure test exhaust system every 12 mo.
 Replace multi-segment V-band clamps every 500 hrs
 Remove the exhaust system from the slip joints aft to all turbo charger components every 2,500 hrs. or 12 yrs. which ever occurs first.

Pay special attention to:

- A Inspect all slip joints for movement
- B Check flow divider plate for cracks or distortion
- C Check tailpipe for internal pitting and wall thickness

ITEM	OEM PART NO	DESCRIPTION	Condition
01	0850660-7	LH STACK ASSY	OH
02	0850660-6	RH STACK ASSY	OH
03	A9910296-7	SLIPJOINT	NEW
04	0850655-11	RE HEADER	OH
04	0850655-53	RE HEADER	OH
05	0850655-18	RE ELBOW	OH
06	0850655-27	LE HEADER	OH
06	0850655-54	LE HEADER	OH
07	0850655-22	LE ELBOW	OH
08	0850655-23	LE ELBOW	OH
09	0850656-1	LH OVERBOARD	OH
09	0850656-2	RH OVERBOARD	OH
09	0850656-24	RH OVERBOARD	OH
09	0850656-25	LH OVERBOARD	OH
NS	0851565-7	LH WASTEGATE	
NS	0851565-8	RH WASTEGATE	